

MODIFICATION INSTRUCTIONS

1. Replace the X-Y monitor with a modified monitor.
2. Do ECN 978 on the CPU board. See attached instructions.
3. Do ECN 991 on the X-Y timing board. See attached instructions.
4. Record the game and monitor serial numbers on the distributor record sheet.
5. Place the colored label on the top left corner of the kick plate.
6. Each team will have the number of games the distributor has purchased. There is a good possibility that number will not be in the distributor's location. Leave the correct number to make up the difference.
7. The removed monitors should be loaded on your truck and returned to Gremlin with you. There will be special cases when these instructions will change.
8. Provide the distributor with a copy of the Distributor Record Sheet, be sure to bring the original back with you.

EFFECT:


X-Y TIMING BOARD

NUMBER: 007

September 17, 1981

To ensure that the vertical and horizontal outputs of the G-80 X-Y Timing Board do not exceed a preset level, the addition of 2 diodes is recommended. The diodes, type 1N914, are installed as follows:

1. Remove the G-80 Timing Board from the card cage.
2. Solder the ANODE of one diode to Pin 1 of the Molex connector located on the front edge of the Timing Board. It is recommended that the diode be installed on the underside of the board.
3. Solder the CATHODE of the diode to a +5 volt pad on the back of the board. This can be found at the +5 volt pin on the closest IC.
4. Install the CATHODE of the second diode to +5, in the same way. Then, solder the ANODE of this diode to Pin 4 of the Molex connector.

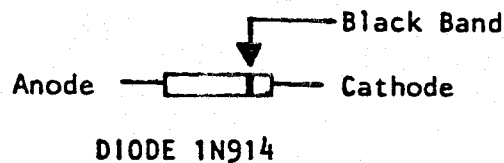

PART NUMBER

151-0031

QUANTITY

ORIGINATOR

DEPT.

50

DATE

8-21-81

REASON FOR VARIANCE

151-0031 CERAMIC CAPACITOR .22UF 16V
IS NOT AVAILABLE IN THE TIME FRAME REQUIRED

WILL VARIANCE BE ACCEPTED ON FUTURE LOTS

☐

YES

☒

NO

IS ECR REQUIRED

☐

YES

☐

NO

ECR WRITTEN BY

DATE

CHECK APPLICABLE DOCUMENTS AFFECTED BY VARIANCE

☐

ENGINEERING DRAWINGS

☒

MFG. PROCESS DETAIL

☒

PURCHASE ORDER

☐

SCHEMATICS

☐

RECEIVING REPORT

☐

BOM

☐

OTHER

AUTHORIZATION FOR SUBSTITUTE MATERIAL

PART NUMBER

151-0031

DESCRIPTION

CAPACITOR
.22UF 16V CER DISC

REQUESTOR

DEPT.

DATE

SUBSTITUTE MATERIAL USE GREMLIN P/N 152-0029 .33UF 250V

CERAMIC CAPACITORS TO REPLACE 151-0031 ON C45 OF

QUANTITY OF END ITEM AFFECTED

CPU BOARD ASSY 800-0107

AUTHORIZED BY

T. Hansen

DATE

8/21/81

DATE

GREMLIN

ENGINEERING CHANGE NOTICE

TE: 8-22-81

ECN # 978

SHEET: 1 OF 1

(REF ECR #370)

EFFECTIVE DATE	ASSEMBLY	PART NUMBER	DRAWING NUMBER	REV
8-24-81	CPU BOARD	800-0107	800-0107	E

CHANGE: PARTS LIST:

ITEM 1 P/N 150-0088 QTY 153 WAS 4 REF DES 15 C43C46.C62 WAS C43.C45.C46.C62

ADD ITEM 58:

P/N 151-0031 QTY (1) CAP CER .22UF 16V C45

CHANGE SHEET 6 ZONE 7A:

IS: $\frac{1}{\text{---}}$ C45
.22UF
16V

WAS: $\frac{1}{\text{---}}$ C45
10UF
25V

REASON FOR CHANGE:

REDUCE POWER ON DELAY FROM 1.5 SECS TO 20 MSECS
TO ALLOW XV MONITOR OUTPUTS TO BE RESET IN 20
MSECS THEREBY REDUCING STRESS ON MONITOR
OUTPUT CIRCUITS

CLASS OF CHANGE - CHECK ONE ONLY

- ☒ A EMERGENCY. INCORPORATE IN PRODUCTION AT ONCE.
ALL ASSEMBLIES, PARTS ISSUED TO ASSEMBLY AREAS AND
PARTS IN STOCK AFFECTED.
- ☐ B URGENT. AFFECTS PARTS FOR WHICH PRODUCTION ORDERS
HAVE BEEN INITIATED BUT NOT COMPLETED, PURCHASE
REQUISITIONS, FINISHED PARTS IN STOCK, PARTS
ISSUED TO ASSEMBLY AREAS, AFFECTS SUB-ASSEMBLIES
AND FINAL ASSEMBLIES.
- ☐ C AFFECTS ALL FUTURE PARTS FOR WHICH PRODUCTION
ORDERS HAVE NOT YET BEEN INITIATED, BUT CHANGE
NEED NOT BE CARRIED OUT UNTIL STOCK IS BALANCED.
- ☐ D AFFECTS NO PARTS OR ASSEMBLIES-FOR INFORMATION
AND RECORDS ONLY.

DISTRIBUTION

- ☒ MANUFACTURING
- ☒ DRAFTING
- ☒ TEST
- ☒ PURCHASING
- ☒ OUTSIDE
VENDOR
- ☒ Q.C.
- ☒ C.S.


REQUESTED BY AND DATE:

G. HANSEN 8-22-81

APPROVED BY AND DATE:

1. Hansen 8-22-81

IN 2 BOARD

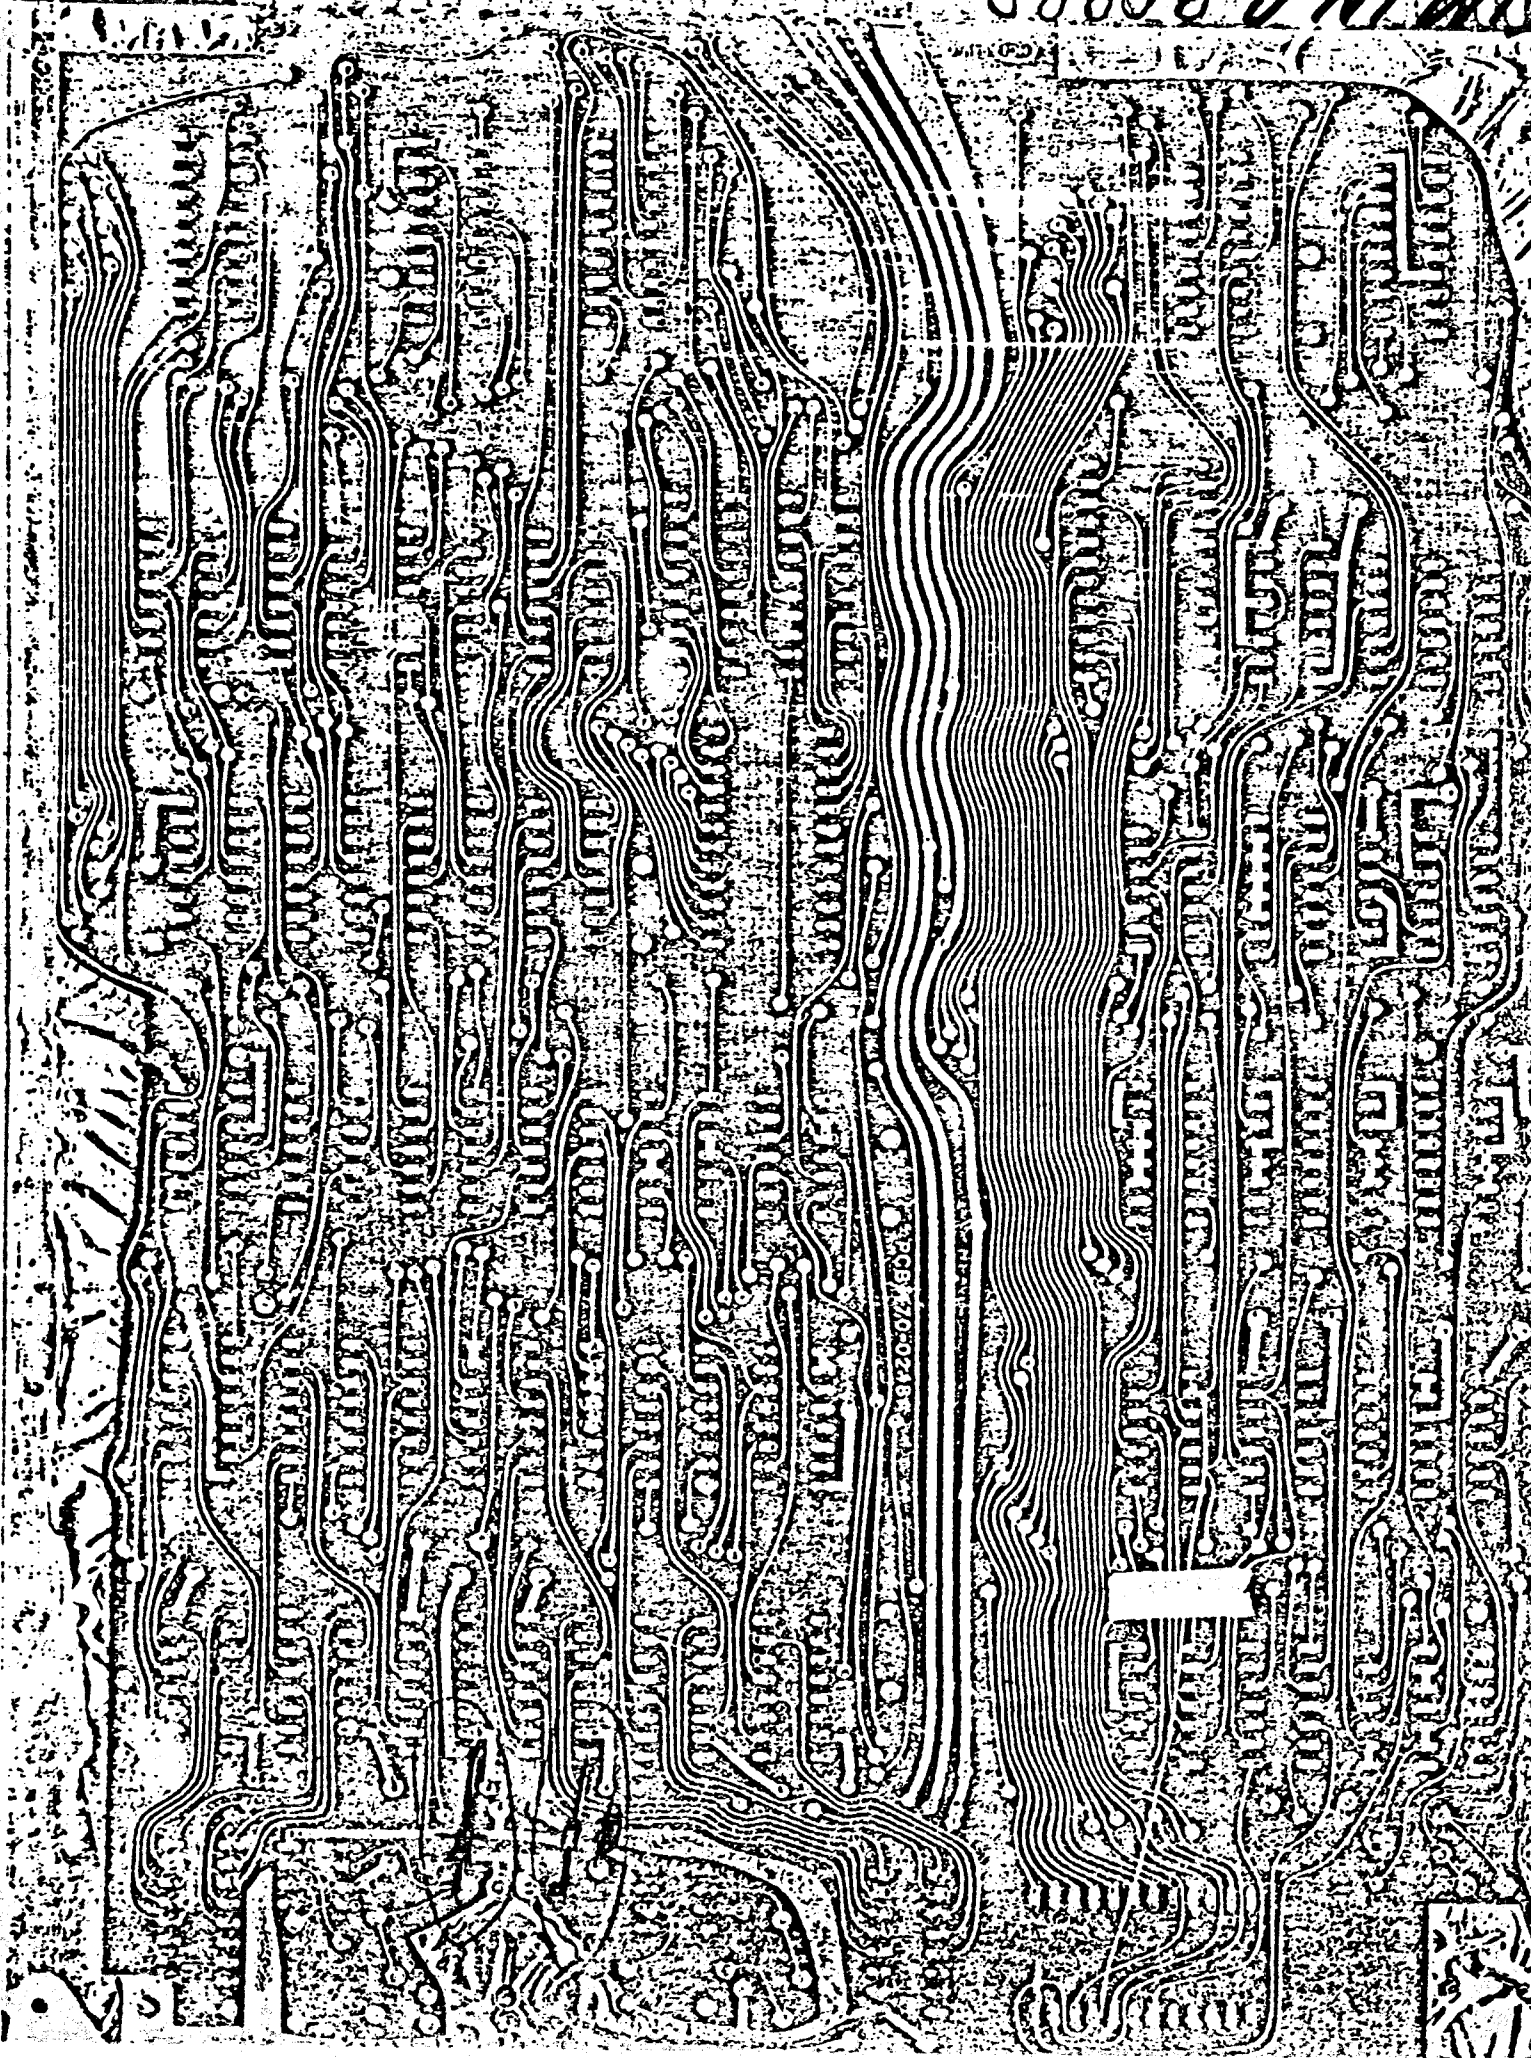

59-1

SW1
SW2
SW3
SW4
SW5
SW6
SW7
SW8
SW9
SW10
SW11
SW12
SW13
SW14
SW15
SW16
SW17
SW18
SW19
SW20
SW21
SW22
SW23
SW24
SW25
SW26
SW27
SW28
SW29
SW30
SW31
SW32
SW33
SW34
SW35
SW36
SW37
SW38
SW39
SW40
SW41
SW42
SW43
SW44
SW45
SW46
SW47
SW48
SW49
SW50
SW51
SW52
SW53
SW54
SW55
SW56
SW57
SW58
SW59
SW60
SW61
SW62
SW63
SW64
SW65
SW66
SW67
SW68
SW69
SW70
SW71
SW72
SW73
SW74
SW75
SW76
SW77
SW78
SW79
SW80
SW81
SW82
SW83
SW84
SW85
SW86
SW87
SW88
SW89
SW90
SW91
SW92
SW93
SW94
SW95
SW96
SW97
SW98
SW99
SW100

Q5
C45

999

Centim/SGA
MADE IN U.S.A.

1044

Monitor Removal

Release the fasteners on the control panel and swing it down.

Directly under the the front plexiglass, you will notice a small frame support piece. Grab it by the hand slot in the middle and pull it from the game. The front plexiglass can now be removed easily by lifting it on the bottom slightly and pulling it outward. Next, remove the interior graphics. The graphics frame, located directly behind the interior graphics, can be removed by gripping two sides and carefully lifting it out. Now open the the rear panel on the cabinet and disconnect the power cable and video cable to the monitor. Now go back to the front and remove the four bolts in each corner of the monitor board. Now grasp the board by the hand holds provided at the top and bottom and pull the monitor from the cabinet. To replace follow the same procedure in reverse except you will notice on the rear of the new monitor there is an extra board added. Mount this board on the cabinet with the tie wraps provided and the connector coming from this board is plugged into the video cable. Reconnect the power cable as usual. Before closing up, ensure that the heat sinks on the driver transistors are not touching each other.